

#SAFERCARSFORAFRICA

Renault TRIBER












SPECIFICATIONS

Tested model	Renault Triber
Body type	5 door MPV
Year of publication	2024
Crash test weight (KG)	1166
VIN from which Rating applies	
Made in	India
Test valid for	Africa

SAFETY EQUIPMENT

	DRIVER	PASSENGER	REAR			
FRONTAL CRASH PROTECTION						
	T		T			
Frontal airbag	YES - STANDARD	YES - STANDARD	NOT APPLICABLE			
Belt pretensioner	YES - STANDARD	NOT AVAILABLE	NOT AVAILABLE			
Belt Loadlimiter	YES - STANDARD	YES - STANDARD	NOT AVAILABLE			
Knee airbag	NOT AVAILABLE	NOT AVAILABLE	NOT APPLICABLE			
SIDE CRASH PROTECTION						
Side head curtain airbag	NOT AVAILABLE	NOT AVAILABLE	NOT AVAILABLE			
Side head (thorax head) airbag	NOT AVAILABLE	NOT AVAILABLE	NOT AVAILABLE			
Side chest airbag	NO - OPTIONAL	NO - OPTIONAL	NOT AVAILABLE			
Side pelvis airbag	NOT AVAILABLE NOT AVAILABLE NOT AVAILAB					
CHILD PROTECTION						
ISOFIX	NOT APPLICABLE	NOT AVAILABLE	NOT AVAILABLE			
Integrated CRS	NOT APPLICABLE	NOT AVAILABLE	NOT AVAILABLE			
Airbag cut-off switch	NOT APPLICABLE	NOT AVAILABLE	NOT APPLICABLE			
SAFETY ASSIST						
Seat Belt Reminder (SBR)	YES - STANDARD	YES - STANDARD	NOT AVAILABLE			
OTHER SAFETY SYSTEMS						
ESC standard	NO - OPTIONAL					
GTR 9 - UN 127 Pedestrian protection	NOT AVAILABLE					
AEB Pedestrian	NOT AVAILABLE	NOT AVAILABLE				
AEB City	NOT AVAILABLE					
AEB Inter-Urban	NOT AVAILABLE					
Speed Assist System	NO - OPTIONAL					
Lane Assist system	NOT AVAILABLE					

ADULT OCCUPANT PROTECTION

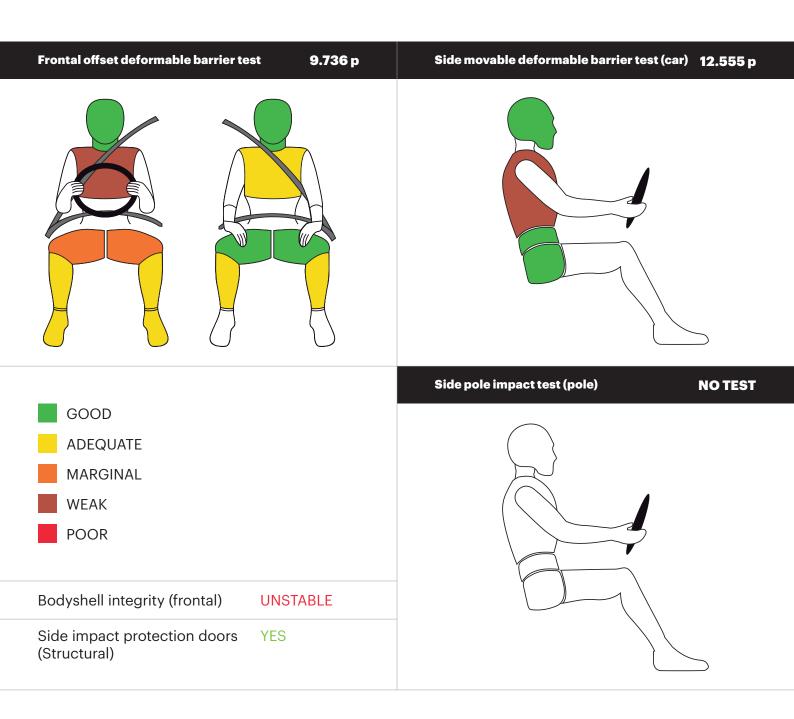

Comments

Frontal impact: the protection offered to the driver's and passenger's head and neck was good. Driver's chest showed weak protection and passenger's chest adequate protection. Driver's knees showed marginal protection as they can impact with dangerous structures behind the fascia. Passenger's knees showed good protection. Driver's and passenger's tibias showed adequate protection. Footwell area was rated as stable but not symmetrical to the passenger side. The bodyshell was rated as unstable and it is not capable of withstanding further loadings.

Side impact: head, abdomen and pelvis showed good protection, chest showed weak protection.

Side pole impact: it was not performed as this model does not offer side head protection even as optional.

ESC is not fitted as standard.

SBR is standard in front seating positions and meets the requirements. All this explained the 2 star result.

CHILD OCCUPANT PROTECTION

CHILD RESTRAINT SYSTEM

Dynamic score 17.04 (max 24.00)

CRS Installation Score 2.95 (max 12.00)

Vehicle assessment score

0.00 (max 13.00)

	Child restraint	Dynamic score	CRS Type	Adjust	Position
18 month old child	Britax Roemer Baby Safe	Front 8.00 (8 max) Side 4.00 (4 max)	0+	BELTED	RWF
3 year old child	Britax Roemer Duo	Front 1.04 (8 max) Side 4.00 (4 max)	I	BELTED	FWF

	Front Passenger	2nd row outboard	2nd row centre
ISOFIX	NOT AVAILABLE	NOT AVAILABLE	NOT AVAILABLE
i-Size	NOT AVAILABLE	NOT AVAILABLE	NOT AVAILABLE
Integrated CRS	NOT AVAILABLE	NOT AVAILABLE	NOT AVAILABLE

CRS INSTALLATION ASSESSMENT

PASS

FAIL

EXEMPT

		1ST ROW		2ND ROW			3RD ROW		
REFERENCE LIST		LEFT	LEFT	CENTER	RIGHT	LEFT	CENTER	RIGHT	
Group 0+	Peg Perego Viaggio Switchable (BELTED)	0	•	•		•	N/A	•	
Group 0+	Roemer Baby Safe (ISOFIX / LEG)	N/A	N/A	N/A	N/A	N/A	N/A	N/A	
Group 0+	Bébé Confort Stry Fix / Maxi Cosi Citi (BELTED)	0	•	•	•	•	N/A	•	
Group I	Peg Perego Viaggio Switchable FWF (BELTED)	0	•	•	•	•	N/A	•	
Group I	Graco Cadeira Nautilus FWF (BELTED)	0	•	•	•	0	N/A	0	
Group II/II	Burigotto Multipla 1,2,3 (BELTED)	0	•	•	•	0	N/A	0	
Group II/II	Graco Cadeira Nautilus (BELTED)	0	•	•	•	0	N/A	0	
MANUFACTURTER									
Q1.5	Britax Roemer Duo Baby Safe (BELTED)	0	•	•	•	N/A	N/A	N/A	
Q3	Britax Roemer Duo Plus (BELTED)	0	•	•	•	N/A	N/A	N/A	

Comments

Frontal impact: The child seat for the 3 year old was installed forward facing using the adult belt and it was not able to prevent forward head exposure during the frontal impact. Neck and chest protection was weak to poor. The child seat for the 18 month old was installed rearward facing using the adult belt and it was able to prevent head exposure during the frontal impact offering full protection.

Side impact: both CRS's offered full side impact protection.

The car does not offer 3 point belts in all seating positions as standard. The marking warning consumers about the risk of a rearward facing CRS in the front passenger position fulfils the requirements but it does not offer the possibility to disconnect the passenger airbag in case a rearward facing CRS will be installed in this position. The CRS installation failed for the centre position and third row positions.